


Mont Blanc Remote Control Issue

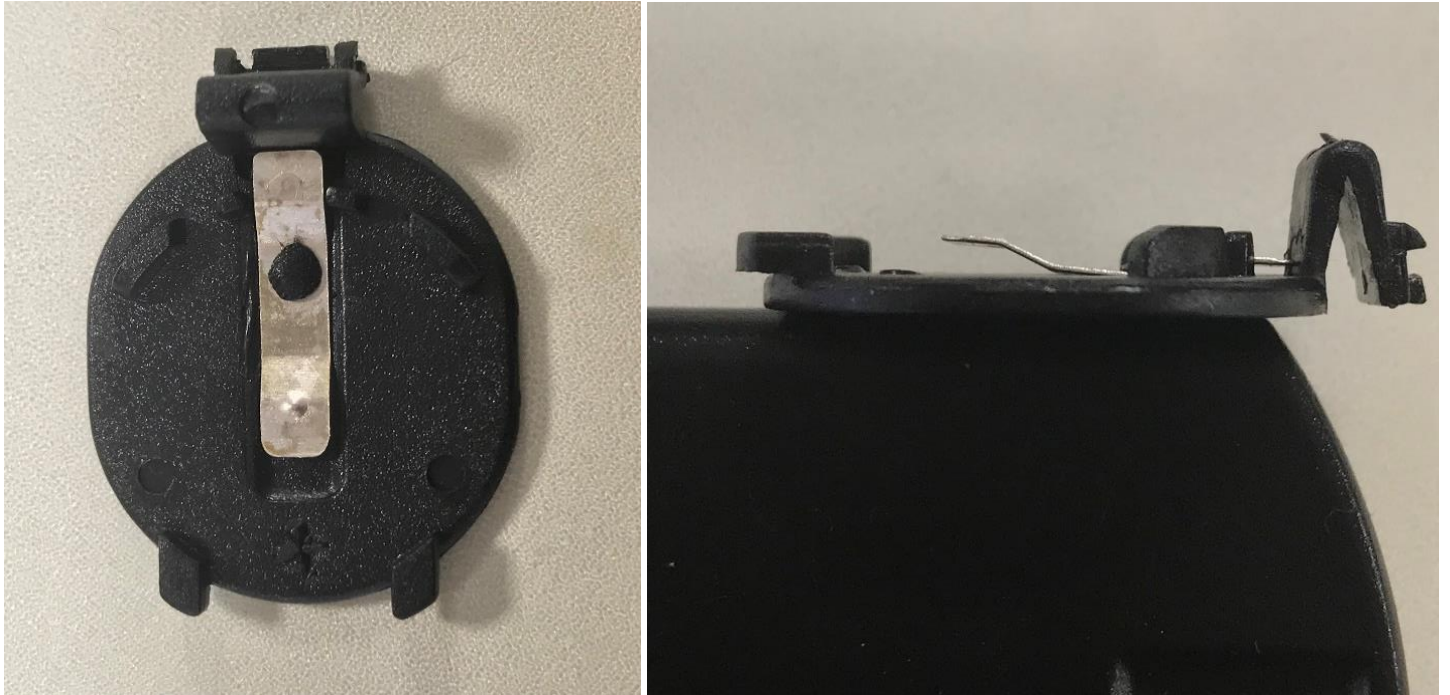

Following an increasing number of reports of faulty Remote Controls used to operate the Mont Blanc Fan, a number were returned for inspection/testing. As a result it was discovered that the metal contact tab on the reverse side of the lid to the battery housing was not making contact with the battery surface as it is required to do. This issue can be easily resolved by the customer. Simply place a finger under the lip of the tab and gently lift until it is sat 'proud' of the lid. This will ensure that the tab will make contact with the battery when the lid is located.